

402™, 502™, 802® II Controllers

180520

Figure correction in service manuals

November 1, 1994

The block diagram in these manuals is incorrect. This affects the following figures:


502 manual (P/N 170310) Figure 12

402, 802 II manual (P/N 174785) Figure 22

For example, in the original block diagram, for the **Channel 1 High Frequency Output, P7-6 (+)** is shown connected to **pin 3**. In reality, it's connected to **pin 2**. All output connections have been corrected in the new diagram. This agrees with the controller schematics in both manuals.

Additionally, the **Channel 2 High and Low Freq. outputs** had their connections listed backwards. **P11 (Low Freq.)** is now **P12**, and **P12 (High Freq.)** is now **P11**.

A corrected block diagram is attached. This replaces both figures mentioned above.

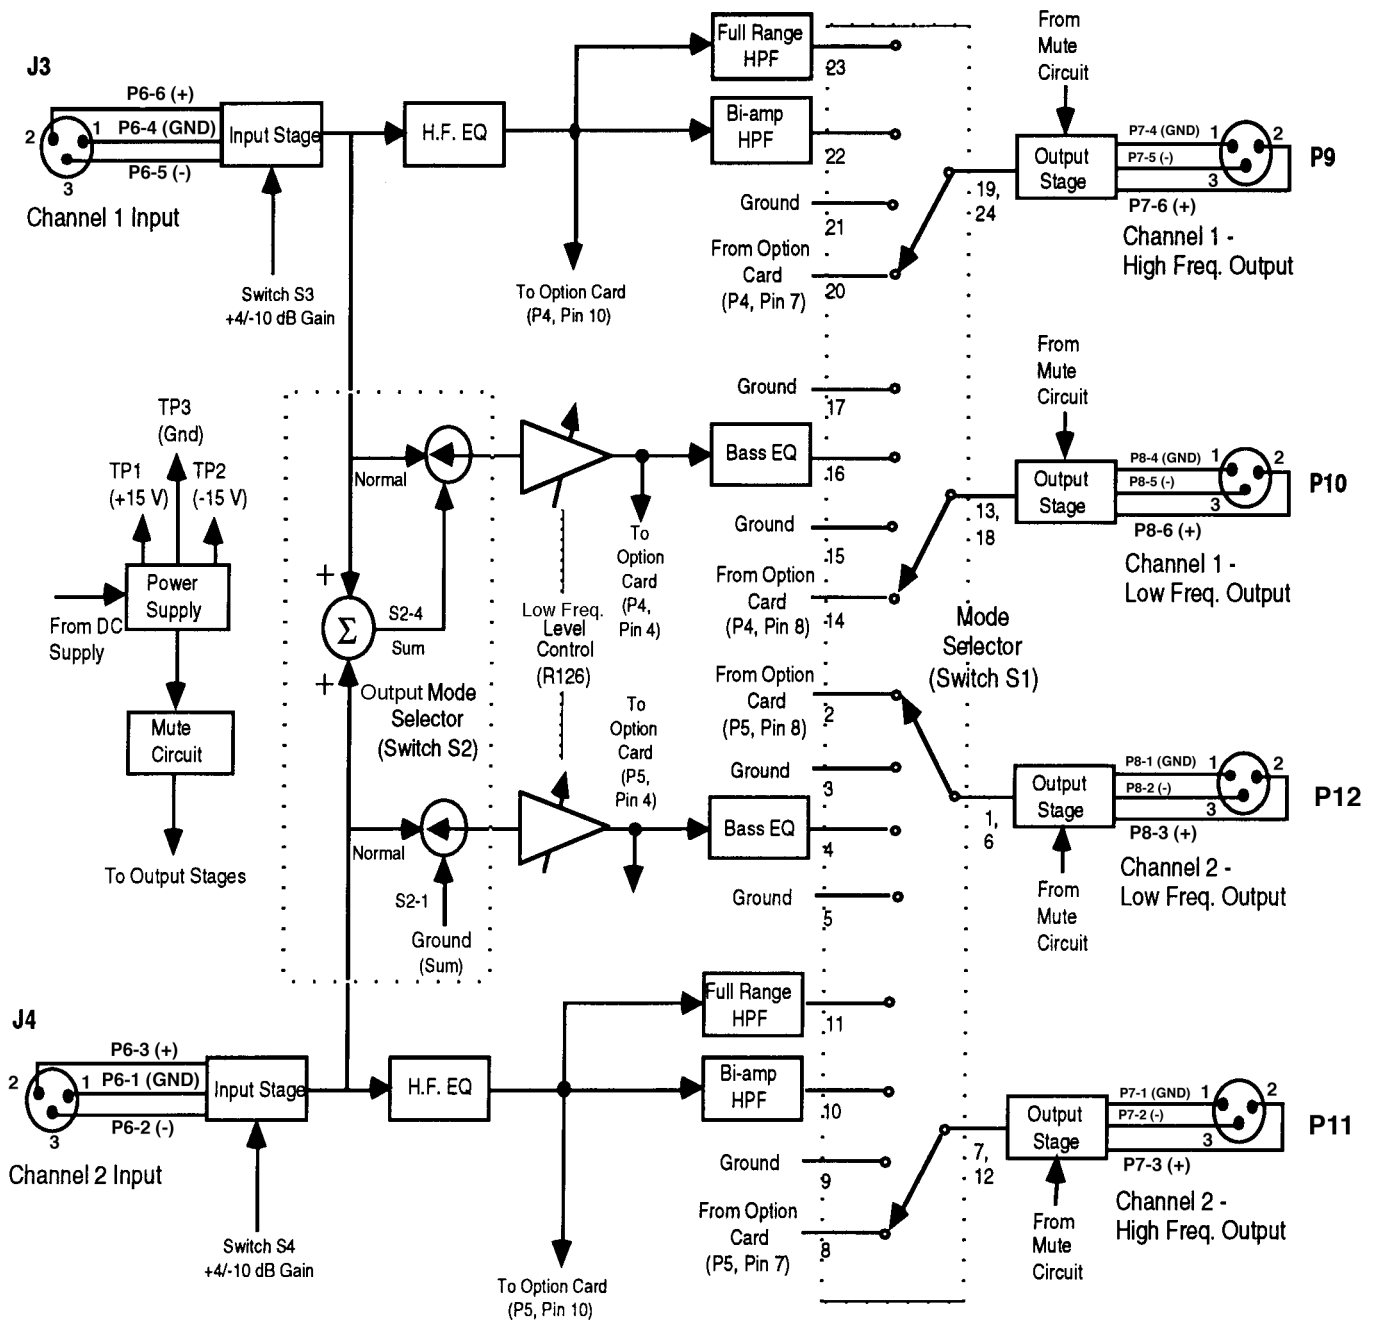

Corrected block diagram